




## **High Temperature IR Thermometer**

Measures up to 1000°C with 50 to 1 distance to target ratio

With laser pointer to identify target area

## **Features:**

- Highest 50 to 1 distance to target ratio measures smaller surface areas at greater distances
- Adjustable high/low alarm alerts user visually and audibly when temperature exceeds programmed limits
- MIN/MAX/AVG/DIF features display highest, lowest, average, and MAX minus MIN values
- · Complete with 9V battery and hard carrying case

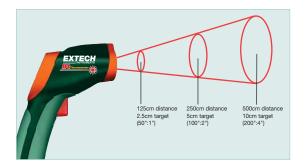



Measure temperature in hard to reach places

## **Ordering Information:**

42545.....High Temperature IR Thermometer



Specifications	
Range	-50 to 1000°C (58 to 1832°F)
Basic Accuracy	±2% of rdg 2°C/+4°F
Max. Resolution	0.1°C/°F
Emissivity	Adjustable
Field of View (Distance to Target)	50:1
Dimensions	100 x 56 x 230mm (3.9 x 2.2 x 9")
Weight	290g (10.2oz)

